

Work Order ID 158276

Thursday, March 16, 2017 2:37:11 PM

U/R

OK 4/17/17

158276

Page 1

Item ID: D119-646-041

Accept

N900040100

Setup Start

NS1

Revision ID: URF 15-560

Stop

NS2

Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 4/10/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED/C

Approvals: Process Plan:

DAS
21
9-89

Date: MAR 16 2017

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3887-041	D								
IIN-D119-646	C								

100

0.00

100

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile & type labels per PPP D119-646-041 CHG004

110

0.00

110

Skidtubes

Memo

0.00

Skidtubes

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

1 M64 17/03/23

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 2

Item ID: D119-646-041
Revision ID: URF 15-560
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 **Start Qty:** 1.00
Required Date: 4/10/2017 **Req'd Qty:** 1.00
Reference: SCHEDULED/C

Accept***N900040100*****Setup Start *NS1*****Stop *NS2*****Cust Item ID:****Customer:**

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run Start *NR1***Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.72							
Hand Finishing									
121	QC7-Inspect Chemical Conversion Coat	0.00							
121									
QC	Memo	0.00							
Quality Control									
122	QC5- Inspect part completeness to step on W/O	0.00							
122									
QC	Memo	0.00							
Quality Control									

DAS
18
3-23DAS
18
3-23

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 3

Item ID: D119-646-041 Accept

Revision ID: URF 15-560

Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017 Start Qty: 1.00 *1*

Required Date: 4/10/2017 Req'd Qty: 1.00 *1*

Reference: SCHEDULED/C

N900040100Setup Start ***NS1***Stop ***NS2***

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

0.00

130

Skidtubes

Skidtubes

Memo

0.00

1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.

2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.

3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477

4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***

5- Deburr, blow out chips from inside of tube.

6- Bond web in place as per Dwg D3887 & QSI 015.

A/RSikaflex-291 M136652Sikaflex expire date: 17-12-07

Start: _____ Time: _____

Finish: _____ Time: _____

***** (Adhere for 12 hours) ***** 10:00

<u>1</u>	<u>0</u>	<u>17-03-24</u>	<u>DT</u>
----------	----------	-----------------	-----------

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 4

Item ID: D119-646-041 **Accept** ***N900040100*** **Setup Start *NS1***
Revision ID: URF 15-560 **Stop *NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 **Start Qty:** 1.00 ***1*** **Cust Item ID:**
Required Date: 4/10/2017 **Req'd Qty:** 1.00 ***1*** **Customer:**
Reference: SCHEDULED/C

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____ **Run Start *NR1***
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____ **Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

135

QC5- Inspect part completeness to step on W/O

0.00


135

QC

Memo

0.00

Quality Control

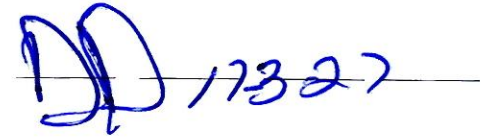

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 5

Item ID: D119-646-041
Revision ID: URF 15-560
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 **Start Qty:** 1.00
Required Date: 4/10/2017 **Req'd Qty:** 1.00
Reference: SCHEDULED/C

Accept***N900040100***

Setup Start ***NS1***
Stop ***NS2***

Cust Item ID:
Customer:

Approvals: **Process Plan:** **Date:** **Tooling:** **Date:**
QC: **Date:** **SPC (Y/N):** **Date:**

Run Start ***NR1***
Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140		0.00							
140									
Skidtubes									
Skidtubes									
	Memo	0.00							
	1- Bend FWD end of tube using bender 1 and FOLIO 31 bend prog. D3887.***Must use bending aid DT9544, ensure proper positioning***								
	2- Cut FWD end of tube as per dwg D3887.***Verify measurment***								
	3- Buff out marks left from bending								
	4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"								
	5- Open FWD saddle holes to finished size as per dwg D3887								
	6- Drill FWD x-bolt spacer holes using DT9816 and open to finished size.(verify measurement)								
	7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify measurement). Open to finished size.								
	8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg.								
	9- C'sink FWD cap hole as per detail "C"								
	10- Drill holes for wearpads using DT8931, open to 0.297".								
	11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.								
	12- Deburr and blow out chips from inside of tube.								

17-03-27
DT

17-03-28
DT

Work Order ID 158276***158276***

Page 6

Thursday, March 16, 2017 2:37:12 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150 QC5- Inspect part completeness to step on W/O ✓ 0.00

150

QC

Memo

0.00

Quality Control

1 0 3E 170331

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 7

Item ID: D119-646-041 Accept ***N1900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160		0.00							
160									
Skidtubes	Memo	0.96							
Skidtubes	NOTE: TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD GROUND HANDLING FIXTURE, IF FIXTURE FITS WELL THEN PROCEED. FIXTURE DT10091.								
	1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to back drill each hole before welding the other side. Use aluminum rod A/RAluminum Rod <u>m136158</u>								
	2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.								
	3-Counterbore 5/16" x 0.750" deep as per Dwg D3887.								
	4- Deburr & Scribe batch # on Aft end of tube.								
170	QC5- Inspect part completeness to step on W/O	0.00							
170									
QC	Memo	0.00							
Quality Control	TEST FIT USING FIXTURE DT10091.								

DAS
38
9-89

APR 07 2017

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 8

Item ID: D119-646-041 Accept ***N1900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180

QC10- Inspect visual per QSI004- ground welds

0.00

180

QC

Memo

0.00

Quality Control

DAS
38
APR 07 2017

190

Pressure Wash per QSI005 4.3

0.00

190

HandFinish

Memo

0.44

Hand Finishing

Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.

(X1) 2017/04/10
BEB

200

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

200

Powdercoat

Memo

0.00

Powder Coating

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

★
SEE
AttachedM136657
8:10
320°
8:40

1 φ 1704-11. 334

Work Order ID 158276***158276***

Page 9

Thursday, March 16, 2017 2:37:12 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	QC3- Inspect Part Finish	0.00							
210									
QC	Memo	0.00							
Quality Control									
220		0.00							
220									
HandFinish	Memo	0.00							
Hand Finishing	1-Install inserts as per Dwg D3887.								
230	QC5- Inspect part completeness to step on W/O	0.00							
230									
QC	Memo	0.00							
Quality Control									

DAS
15
9-89DAS
34
9-89

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 10

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 4/10/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference: SCHEDULED/C

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240									
HandFinish									
Hand Finishing									
	Memo	0.00							
	1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers A/R Sikaflex-240/-291 <u>M137127</u> Sikaflex expire date: <u>12/12</u>								
	2-assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: <u>M135473</u>								
	3 -Inspect for foreign objects as per QSI 024								
	4 -Install Aft Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 <u>M137127</u> Sikaflex expire date: <u>12/12</u>								
245	QC5- Inspect part completeness to step on W/O	0.00							
245									
QC									
Quality Control	Memo	0.00							

SEE
Attached

RTU 598 M136761 18/01

DAS
38
9-89
APR 12 2017

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 11

Item ID: D119-646-041 **Accept** ***N900040100*** **Setup** **Start** ***NS1***
Revision ID: URF 15-560 **Stop** ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 3/20/2017 **Start Qty:** 1.00 ***1*** **Cust Item ID:**
Required Date: 4/10/2017 **Req'd Qty:** 1.00 ***1*** **Customer:**
Reference: SCHEDULED/C

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____ **Run** **Start** ***NR1***
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____ **Stop** ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250 *250* HandFinish Hand Finishing	Wing Walk as per dwg QSI005 4.4 Batch <u>M1137052</u> Memo	0.00				<u>12</u>	<u>4</u>	<u>all 4/10/17</u>	
251 *251* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00				<u>1</u>			<u>DAS 38 9-89</u> APR 12 2017
260 *260* Packaging Packaging	Identify as per dwg & Stock Location: _____ Memo <u>PPPKS 909</u>	0.00							<u>DAS 27 9-89</u> APR 12 2017

Work Order ID 158276

Thursday, March 16, 2017 2:37:12 PM

158276

Page 12

Item ID: D119-646-041 Accept

Revision ID: URF 15-560

Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017 Start Qty: 1.00 *1*

Required Date: 4/10/2017 Req'd Qty: 1.00 *1*

Reference: SCHEDULED/C

N900040100Setup Start ***NS1***Stop ***NS2***

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

270

QC21- Final Inspection - Work Order Release

0.00

270

QC

Memo

0.00

Quality Control

DAS
21
9-89

APR 12 2017

DAS
21
9-89

APR 12 2017

Thursday, March 16, 2017 2:37:15 PM

158276

D119-646-041

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-190 *D2500-1-190* Ext'n -T Beam Tube 4"		Manufactured	No			110	Each	53.0000	1	1			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				HALL		53							
				151612		53							
D2579 *D2579* Crossbolt Spacer		Manufactured	No			140	Each	30.0000	2	2			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				LG001		30							
				141711		30							
D2855-3 *D2855-3* Cap		Manufactured	No			240	Each	25.0000	2	2			
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				FP001		25							
				151614		22							
				153291		3							

Picklist Print

Thursday, March 16, 2017 2:37:15 PM

Page 2

Work Order ID: 158276

158276

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1611-005

Purchased

No

240

Each

274.0000

16

16

NAS1611-005

O-RING

**

all 17/04/17

Location

Loc Qty

Loc Code

FP001

274

m136184

23

m136192

1

m136377

150

m137017

100

x16

D3492-5

Manufactured

No

240

Each

134.0000

16

16

D3492-5

Plug

**

all 17/04/17

Location

Loc Qty

Loc Code

FP001

134

133396

8

136396

6

152195

16

152814

3

153738

70

154740

31

B155493

x11

x5

D3672-1

Manufactured

No

240

Each

660.0000

2

2

D3672-1

Washer, Phenolic

**

all 17/04/17

Location

Loc Qty

Loc Code

FG

10

85222

10

FP001

650

112218

4

134785

146

150074

500

x2

Thursday, March 16, 2017 2:37:15 PM

Shop Packet Print

Page 2

Picklist Print

Thursday, March 16, 2017 2:37:15 PM

Work Order ID: 158276

158276

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

D3681-1

Manufactured No

160

Each

80.0000

8

8

D3681-1

Spacer

8617-03-31
*858384 * 8*

Location

Loc Qty

Loc Code

LG001

80

145956

1

151967

4

155381

55

155806

20

D3847-1

Manufactured No

240

Each

70.0000

5

5

D3847-1

Wearpad

17/04/11

Location

Loc Qty

Loc Code

FP001

70

153009

4

153010

11

153011

3

153503

14

155281

12

155776

18

156958

8

D3847-11

Manufactured No

240

Each

23.0000

1

1

D3847-11

Wearpad

17/04/11

Location

Loc Qty

Loc Code

FP001

23

151985

4

151986

1

154225

2

154349

4

155829

6

157006

6

✓

Picklist Print

Thursday, March 16, 2017 2:37:15 PM

Page 4

Work Order ID: 158276

158276

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

D3885-1

Manufactured No

140

Each

15.0000

1

1

D3885-1

Standard Web

**

17-03-24
DT

Location

Loc Qty

Loc Code

LG002

15

152609

15

D3903-1

Manufactured No

160

Each

119.0000

12

12

D3903-1

Spacer

**

BE 17-03-31

Location

Loc Qty

Loc Code

LG001

119

152993

1

154083

9

155755

96

156389

13

ALS4-1032-130

AELS4-1032-130

Purchased

No

220

Each

4,184.000

30

30

AI S4-1032-130

Rivnut

**

all 1710411

Location

Loc Qty

Loc Code

CCK007

4002

M136579

4002

FG

50

FG

M135442

50

FP001

132

M133077

72

M135442

60

x 30

Thursday, March 16, 2017 2:37:15 PM

Shop Packet Print

Page 4

Picklist Print

Thursday, March 16, 2017 2:37:15 PM

Page 5

Work Order ID: 158276

158276

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

AN3C5A

Purchased

No

240

Each

678.0000

32

32

AN3C5A

Bolt

all 17/04/17

Location

Loc Qty

Loc Code

FG

5

122800

5

FP001

102

M136648

102

OVER002

400

M136182

100

M136450

200

M136579

100

ST350

171

M134676

1

M135442

170

x32

Thursday, March 16, 2017 2:37:15 PM

Shop Packet Print

Page 5

Picklist Print

Thursday, March 16, 2017 2:37:15 PM

Page 6

Work Order ID: 158276

158276

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 3/20/2017

Required Date: 4/10/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

Each

3,179.000

32

NAS1149C0332R

WASHER

all 17/04/16

Location

Loc Qty

Loc Code

FP001

284

m136741

46

m136975

238

GA

532

m133284

32

m136444

500

ST260a

2200

m135408

0

m135766

500

m135908

200

m136042

500

m136643

1000

ST266

163

m126319

42

m127831

54

m135466

67

MS24694-C52

Purchased

No

Each

68.0000

2

MS24694-C52

SCREW

all 17/04/16

Location

Loc Qty

Loc Code

FP001

64

m135978

64

ST285

4

m127059

4

Thursday, March 16, 2017 2:37:15 PM

Shop Packet Print

Page 6

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE




QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER : ☐									

8 7 6 5 4 3 2 1

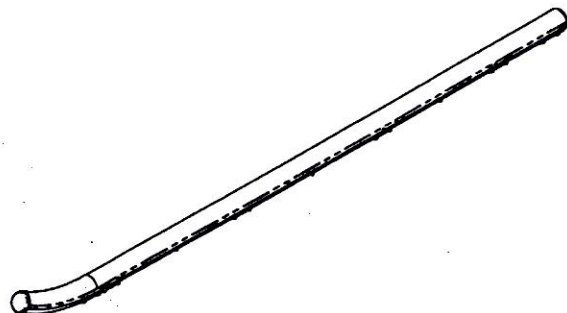

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2579	CROSS BOLT SPACER
11	2	2	2	D2855-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3672-1	PHENOLIC WASHER
14	8	8	8	D3681-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3903-1	SPACER
28			16	D3904-1	WASHER
41	30	30		ALS4-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C48A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN980C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24894-C52	SCREW

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO Ø0.187 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARPLATE INSERTS. INSTALL ALS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/291.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 158276 HCS

17031x

RELEASED

2014 NOV 24

ECN 14-028

UNDER REVIEW

15.04.30 URF15-560 AP

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 135.07 WAS 134.04 (ZN D5-8), ADD 8.07 (ZN C2-5), ADD 116.8 (ZN D5-8), DELETE GASKETS (BOM, SH2)	DB	13.09.20
C	(SHT1, PL, ZN C2-2, C2-2 C4-2) ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24894-C52 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) Ø0.201 CSK Ø0.385 X 100" WAS Ø0.214 THRU, ADDED DETAIL F (ZN C4-5, C4-6, B6-7), ADD ITEM 10, D2579 CROSS BOLT SPACER (ZN C4-1, A6-7)	DB	13.02.19
B	ALS4-1032-130 WAS ALS-1032-130 (ZN C4-1, C5-7, C3-7); ADD DT8931 (ZN A8-1); ADD 134.04 (ZN C4-8); D2855-3 WAS D2579 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C2-2, C2-2, C4-5, C4-6, C2-4); Ø0.313 WAS Ø0.328 (ZN C4-5, C4-6, C2-7 & B3-7) REVISED NOTE 4 (ZN B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED TO ANY OTHER PERSON OR ENTITY WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3C5A BOLT
NAS1149C0332R WASHER
30 PL

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø 0.197
8 PL PER SIDE
REF

1.5 1.5 1.5 1.5

2.00 DISTANCE TO D3885-1 WEB, REF

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR FOR DISSEMINATION TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

AN3C46A BOLT
D3804-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

2.00 DISTANCE TO D3885-1 WEB

1.5 1.5 1.5 1.5

1.5 D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24684-C52 SCREW
(1 PER SIDE)

D3849-041
FWD TRAINING WEARPLATE ASSY

UNDER REVIEW


15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *dp*

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D3887	REV. D
MFG. APPR.	<i>[Signature]</i>	SHEET 4 OF 8	
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PROVIDED AS CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE, OR CONSIDERED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

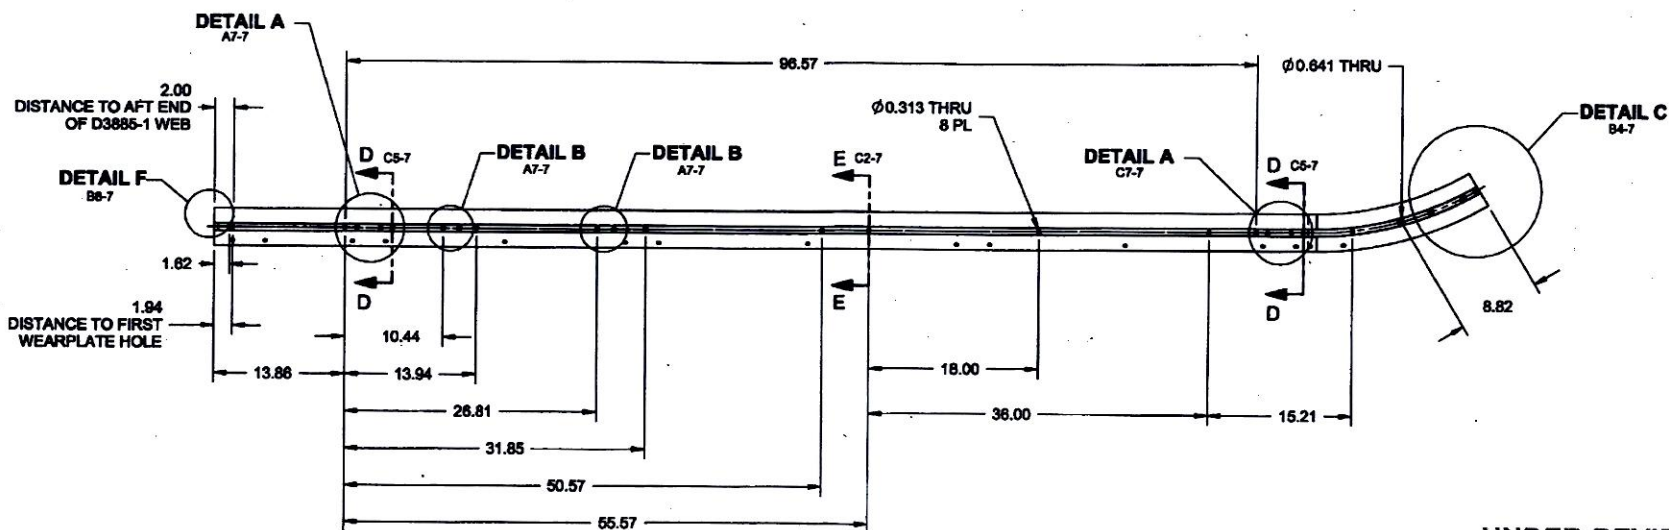

D3887-11 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 5 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS NOT TO BE DISCLOSED OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

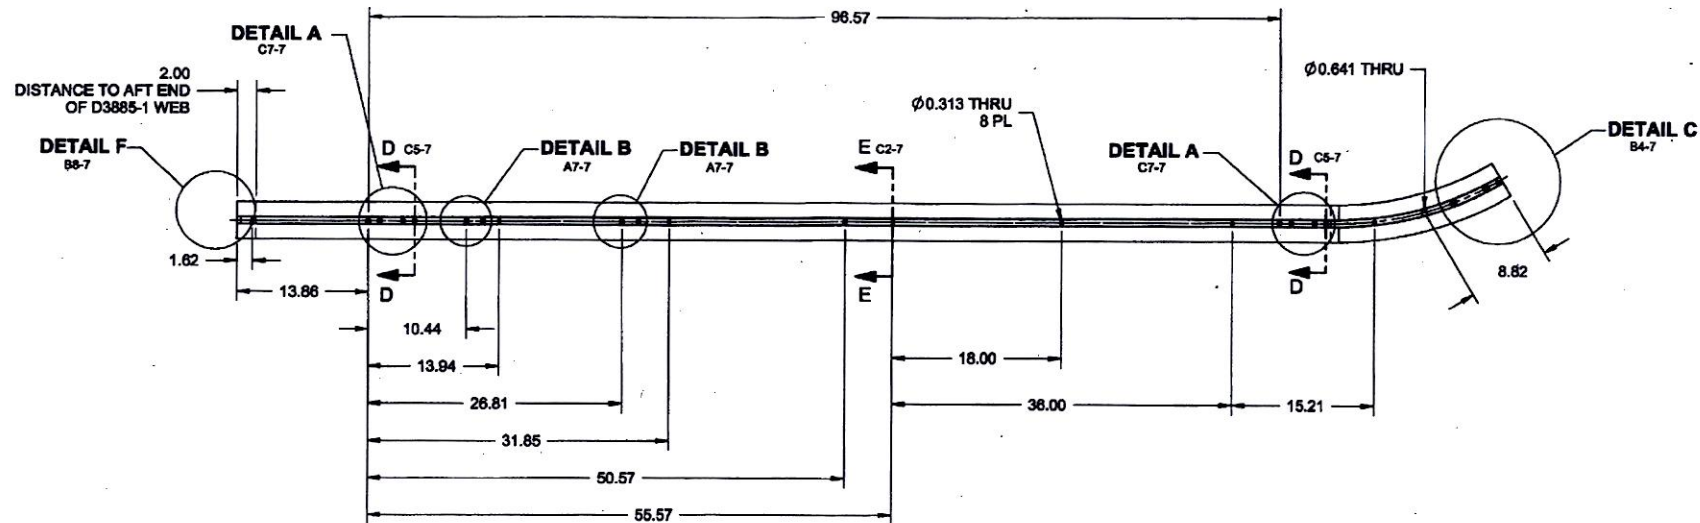

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP


RELEASED

2014 NOV 24 *up*


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

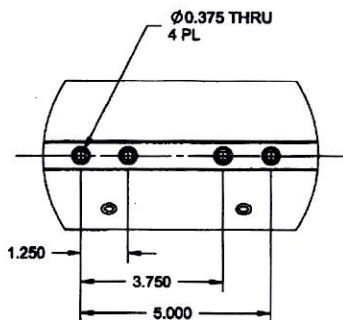


DETAIL A
SCALE 4X
D7-5
C3-5
D7-6
C3-6

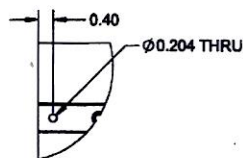


DETAIL F
SCALE 4X
C8-5
C8-6

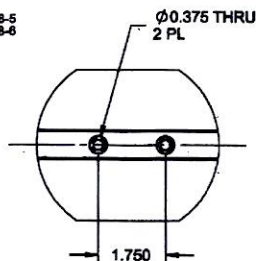


DETAIL B
SCALE 4X
C8-5
C5-5
C8-6
C5-6

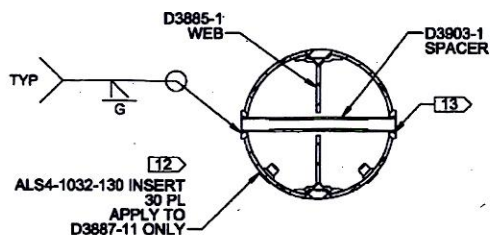

SECTION D-D
SCALE 4X
C7-5
C3-5
C7-6
C2-6
(FOR 12 X Ø0.375 HOLES
PER SKIDTUBE)

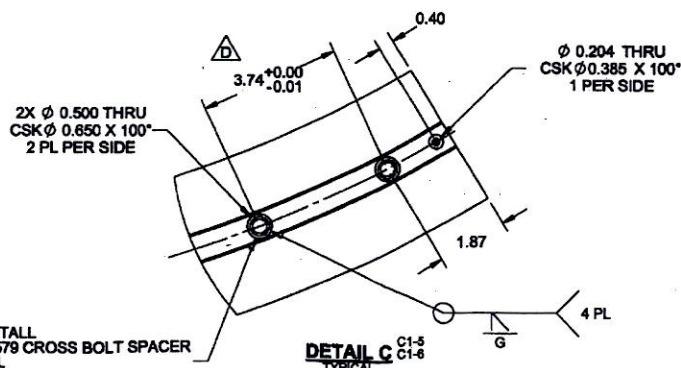

DETAIL C
TYPICAL
SCALE 4X
C1-5
C1-6

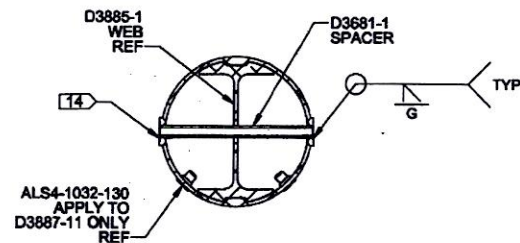

SECTION E-E
SCALE 4X
C4-5
C4-6
(FOR 8 X Ø0.313 HOLES
PER SKIDTUBE)

- NOTES:**
- 13) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:
- i) CHAMFER HOLES Ø0.475 x 45°
 - ii) INSERT D3903-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) CBORE TO 0.313 x 0.75 DEEP
 - v) DEBURR HOLES
- 14) AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.313 HOLES ONLY:
- vi) CHAMFER HOLES Ø0.354 x 45° OR 0.050 DEEP x 45° (BOTH SIDES)
 - vii) INSERT D3681-1 SPACER
 - viii) WELD INTO PLACE AND GRIND FLUSH
 - ix) DEBURR HOLES


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

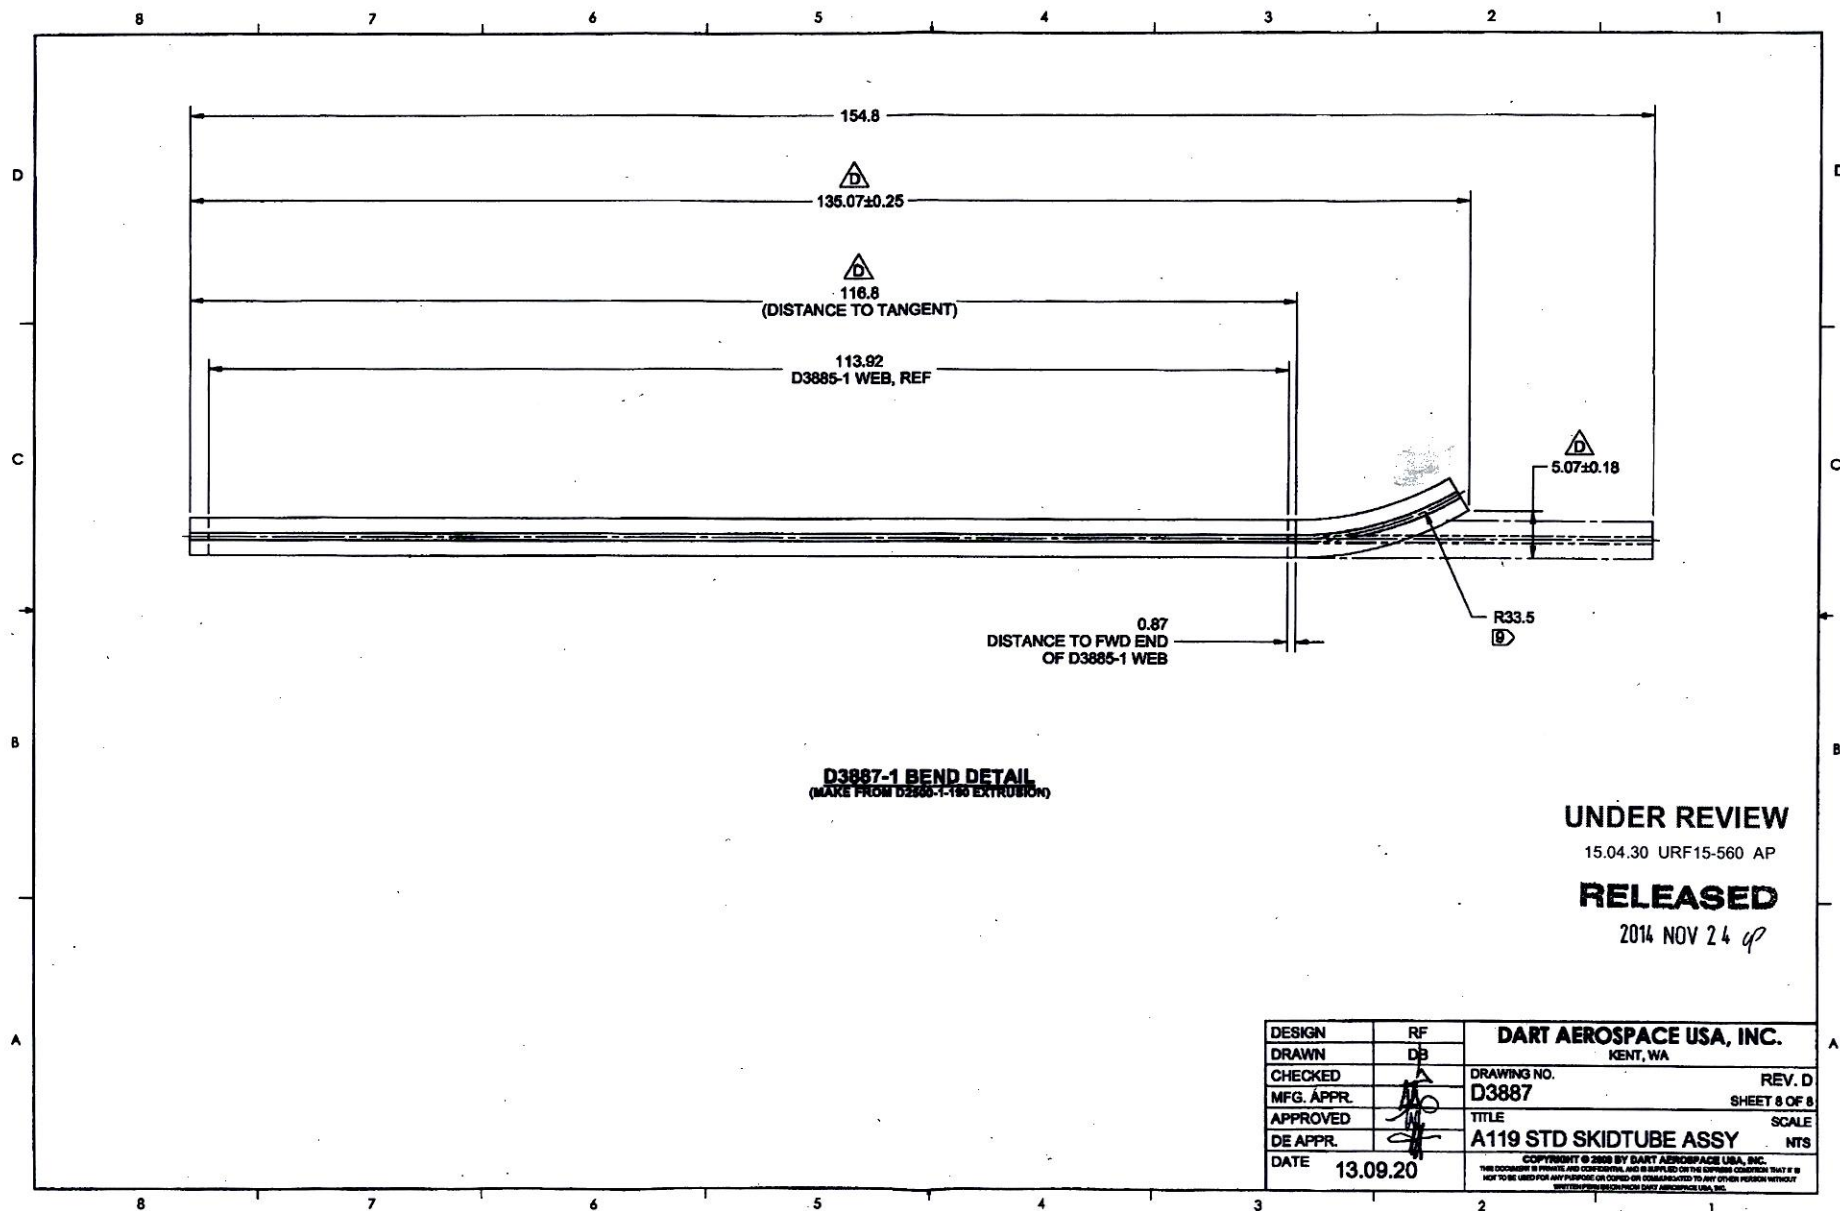

D3887-1 BEND DETAIL
(MAKE FROM D3885-1-180 EXTRUSION)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	DB	DRAWING NO.	REV. D
MFG. APPR.	<i>[Signature]</i>	D3887	SHEET 8 OF 8
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed:

Date:

Work Order update only



Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☒ Quality ☐ Other ☐							
Date : 16/5/16		Step #: 200		QTY Effective :			MRB (QSI042) Approval DAS 12 17/3/17 9-89				
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval			
No powder coat on saddle region per customer request.				Acceptable per attached Masking instructions							
Root Cause		FAULT CATEGORY									
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : Customer							
Misidentified	☐	Past Due	☒								

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☒

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☒</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date : 16/3/16		Step #: 240		QTY Effective :		MRB (QSI042) Approval DAS 12 17/3/17 9-89																			
Description Work Order Deviation				Disposition																					
Plug unused holes with AN3C4A Bolts rather than AN3CSA Bolts.				Acceptable AN3C-4A / M137075 (6)																					
								Completed By DAS 15 17/04/11 9-89																	
								Lead hand / Supervisor Approval Verification																	
				QC / QA Coordinator Approval																					

Root Cause			FAULT CATEGORY		
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

